


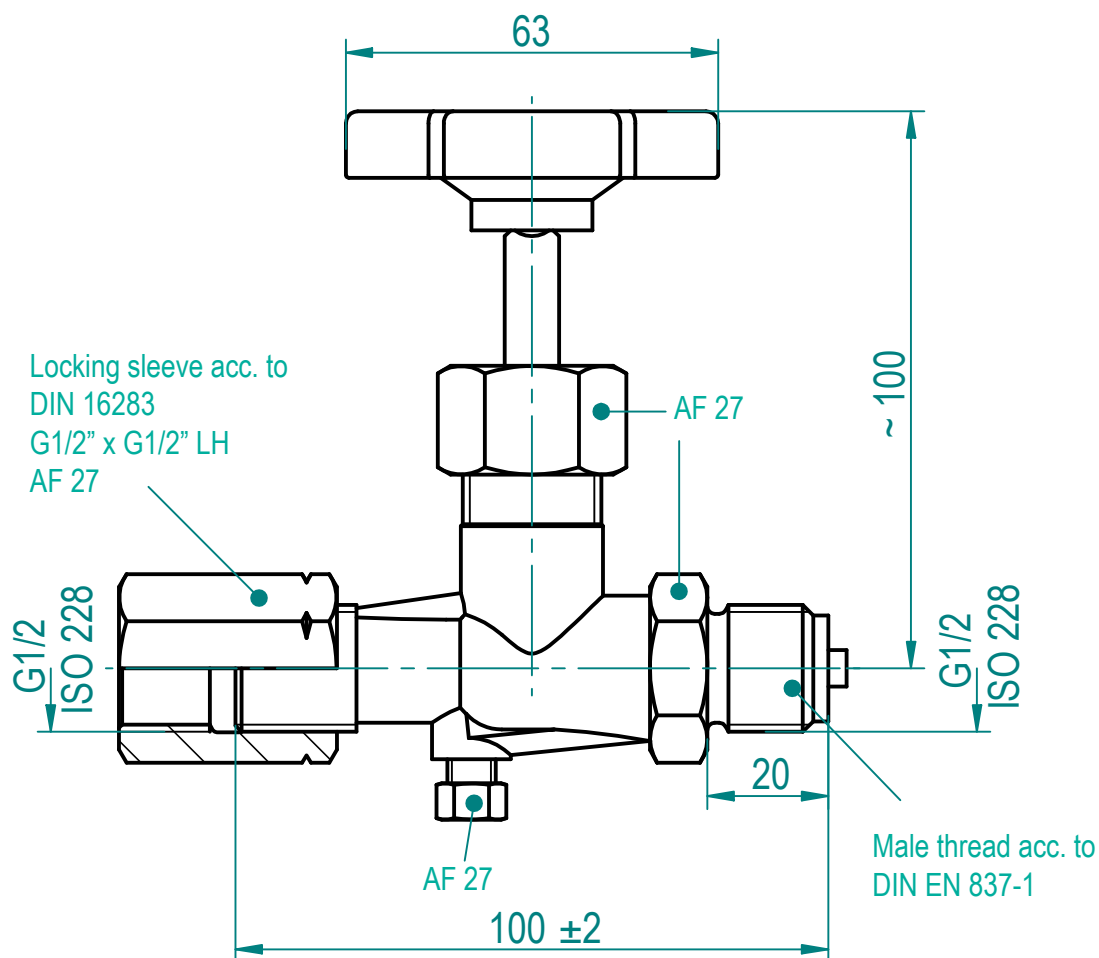


Pressure drop: 50 °C = 6 %, 100 °C = 15 %, 200 °C = 37 %, 300 °C = 60 %, 400 °C = 84 %

Subject to change.


For connection to the Manometer please use a sealing according to DIN 16258

Tolerances according to DIN ISO 2678 part 1 & 2

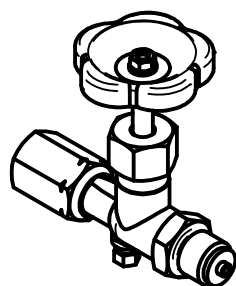

Date	Name	Scale	Material
03.01.2017	Nanko	1:1,25	316Ti

Fig. 60 Manometer gauge valve DIN 16270 A
G1/2" PN400 - 10 °C / + 200 °C

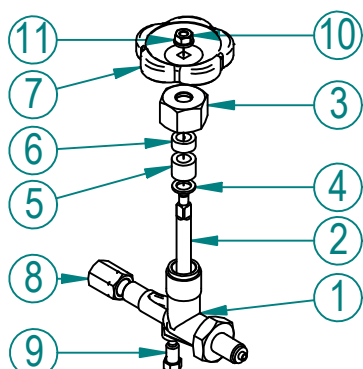

Pos.	Part	Material	Qty
1	Body	316Ti	1
2	Spindle	316Ti	1
	Tip	316Ti	1
3	Nut	316Ti	1
4	Ring	316Ti	1
7	Packing	PTFE	1
6	Gland nut	316Ti	1
7	Handwheel	Plastic	1
8	Locking sleeve	316Ti	1
9	Vent screw	316Ti	1
10	Hexagon nut	316Ti	1
11	Washer	316Ti	1